



EXISTING TREE INVENTORY												
KEY	SPECIES	CALIPER IN (cm)	CROWN IN (m)	HEALTH G/F/P	STRUCTURE	COMMENTS	PRESERVATION DIRECTION	MIN. TPZ	KEY			
1	TREMBLING ASPEN	WHIP-20 15 STEMS > 15 cm DBH		GOOD	NARROW FORM	MINIATURE STAND OF TREES	REMOVE	1.8	1			
2	AUSTRIAN PINE	10-25 5 STEMS > 15cm DBH		POOR- GOOD	ONE SIDED FORM	STAGGERED ROW OF 7 PINE TREES AND 1 BUCKTHORN. 1 DEAD PINE AT WEST EDGE OF GROUPING	REMOVE	1.8	2			
3	CONIFEROUS GROUPING	19-24 5 STEMS > 25cm DBH		GOOD	ONE SIDED FORM	STAGGERED ROW PREDOMINANTLY OF AUSTRIAN PINE AND 1 COLORADO SPRUCE TREE	REMOVE	1.8	3			
4	TREMBLING ASPEN	5-25	8.0	GOOD	MULTI-STEMMED	ONE SIDED FORM, CROWDING BY ADJACENT TREE, LEANING	REMOVE	1.8	4			
5	TREMBLING ASPEN	45.0	10.0	GOOD	GOOD FORM	LOW BRANCHING, DIEBACK ON LOWER BRANCHES	REMOVE	3	5			
6	TREMBLING ASPEN	38.0	7.0	GOOD	ONE SIDED FORM	CROWDING BY ADJACENT TREE, DIEBACK ON LOWER BRANCHES	REMOVE	1.8	6			
7	TREMBLING ASPEN	13-18	7.0	GOOD	DOUBLE STEM	ONE SIDED FORM, CROWDING BY ADJACENT TREE, DIEBACK ON LOWER BRANCHES	REMOVE	1.8	7			
8	TREMBLING ASPEN	36.0	8.0	GOOD	GOOD FORM	MINOR DIEBACK ON LOWER BRANCHES	REMOVE	2.4	8			
9	TREMBLING ASPEN	30-34	8.0	GOOD	DOUBLE STEM	ONE SIDED FORM, CROWDING BY ADJACENT TREE, DIEBACK ON LOWER BRANCHES	REMOVE	2.4	9			
10	TREMBLING ASPEN	22.0	6.0	GOOD	ONE SIDED FORM	CROWDING BY ADJACENT TREE	REMOVE	1.8	10			
11	NATURALIZED GROUP	WHIP-12		GOOD	VARES	SHRUBBY GROUPING COMPOSED MAINLY OF BUCKTHORN AND BLACK LOCUST SAPLINGS	REMOVE	1.8	11			
12	TREMBLING ASPEN	28.0	8.0	GOOD	NARROW FORM	CROWDED AT BASE	REMOVE	1.8	12			
13	WHITE SPRUCE	14-17 2 STEMS > 15cm DBH		POOR- GOOD		REMAINT ROW OF 5 TREES. TREES ARE IN GOOD CONDITION WITH THE EXCEPTION OF 1 DEAD TREE AT THE NORTH END OF THE ROW	REMOVE	1.8	13			
14	BASSWOOD	22.5	6.0	GOOD	GOOD FORM	SOME SUCKER GROWTH AT BASE	REMOVE	1.8	14			
15	SIBERIAN ELM	38.5	9.0	GOOD	GOOD FORM	MULTIPLE LEADERS, DIEBACK ON LOWER BRANCHES	REMOVE	2.4	15			
16	CHERRY	15-28	7.0	GOOD	DOUBLE STEM	ASYMMETRICAL FORM, CROWDING BY ADJACENT TREE	REMOVE	1.8	16			
17	LINEN	42.5	10.0	GOOD	GOOD FORM	MINOR BROKEN LOWER BRANCH	REMOVE	3	17			
18	ENGLISH WALNUT	21.0	8.0	POOR	MULTI-STEMMED	WEAK CROWN, NO SIGNIFICANT CROWN DECLINE, DECAY THROUGHOUT STEMS	REMOVE	1.8	18			
19	WEeping WILLOW	2-10	6.0	GOOD	MULTI-STEMMED	GROWING OUT OF SMALL FILL PILE	REMOVE	1.8	19			
20	WHITE SPRUCE	18.0	4.0	POOR	NARROW FORM	LEANING, DIEBACK ON LOWER BRANCHES	REMOVE	1.8	20			
21	WHITE PINE	16.0	5.0	FAIR	IRREGULAR FORM	CROWDED AT BASE	REMOVE	1.8	21			
22	MANITOBA MAPLE	20.0	6.0	FAIR	MULTI-STEMMED	IRREGULAR FORM, LOWER THIRD OF TREE IS VINE ENTANGLED	REMOVE	1.8	22			
23	WHITE PINE	15.0	4.0	GOOD	GOOD FORM	BRANCHING TO GRADE	REMOVE	1.8	23			
24	MIXED NATURALIZED GROUPING	WHIP-15		GOOD	VARES	MIXED GROUPING OF SAPLINGS COMPOSED OF WHITE PINE, BLACK WALNUT, GREEN ASH AND MANITOBA MAPLE	REMOVE	1.8	24			
25	TREMBLING ASPEN	22.0	6.0	GOOD	GOOD FORM	MINOR DIEBACK ON LOWER BRANCHES	REMOVE	1.8	25			
26	WHITE PINE	18.0	4.0	GOOD	NARROW FORM	CROWDING BY ADJACENT TREE	REMOVE	1.8	26			
27	MANITOBA MAPLE	WHIP-18	8.0	FAIR	MULTI-STEMMED	BROAD FORM, SOME DIEBACK THROUGHOUT	REMOVE	1.8	27			
28	NORWAY MAPLE	27.0	8.0	GOOD	GOOD FORM	ECO-DOMINANT LEADERS	REMOVE	1.8	28			
29	MANITOBA MAPLE	44.0	13.0	GOOD	ASYMMETRICAL FORM	OPEN CROWN, SOME INTERNAL CROWN DIEBACK	REMOVE	3	29			
30	COLORADO SPRUCE	24.0	3.0	POOR	NARROW FORM	W/ DEAD	REMOVE	1.8	30			
31	COLORADO SPRUCE	25.0	4.0	POOR	ONE SIDED FORM	LEANING, CROWDING BY ADJACENT TREE, DIEBACK THROUGHOUT	REMOVE	1.8	31			
32	SILVER MAPLE	34.0	10.0	GOOD	ASYMMETRICAL FORM	CROWDING BY ADJACENT TREE, MINOR CROWN DIEBACK	REMOVE	2.4	32			
33	APPLE	WHIP-16	8.0	GOOD	MULTI-STEMMED	SUBORDINATED FORM, CROWDING BY ADJACENT TREE	REMOVE	1.8	33			
34	SILVER MAPLE	43.5	13.0	GOOD	GOOD FORM	SLIGHTLY LEANING, MULTIPLE LEADERS	REMOVE	3	34			
35	AUSTRIAN PINE	30.0	8.0	GOOD	GOOD FORM	ON ADJACENT PROPERTY	PRESERVE	2.4	35			
36	MANITOBA MAPLE	16-23	5.0	FAIR	DOUBLE STEM	NARROW FORM, CROWDING BY ADJACENT TREE	REMOVE	1.8	36			
37	MANITOBA MAPLE	18-27	10.0	FAIR	DOUBLE STEM	ONE SIDED FORM, CROWDING BY ADJACENT TREE, WEAK CROTCH	REMOVE	1.8	37			
38	AUSTRIAN PINE	35.0	8.0	GOOD	GOOD FORM	ELEVATED CROWN	REMOVE	2.4	38			
39	AUSTRIAN PINE	33.0	6.0	GOOD	IRREGULAR FORM	TOPPED LEADER, CROWDING BY ADJACENT TREE, ELEVATED CROWN	REMOVE	2.4	39			

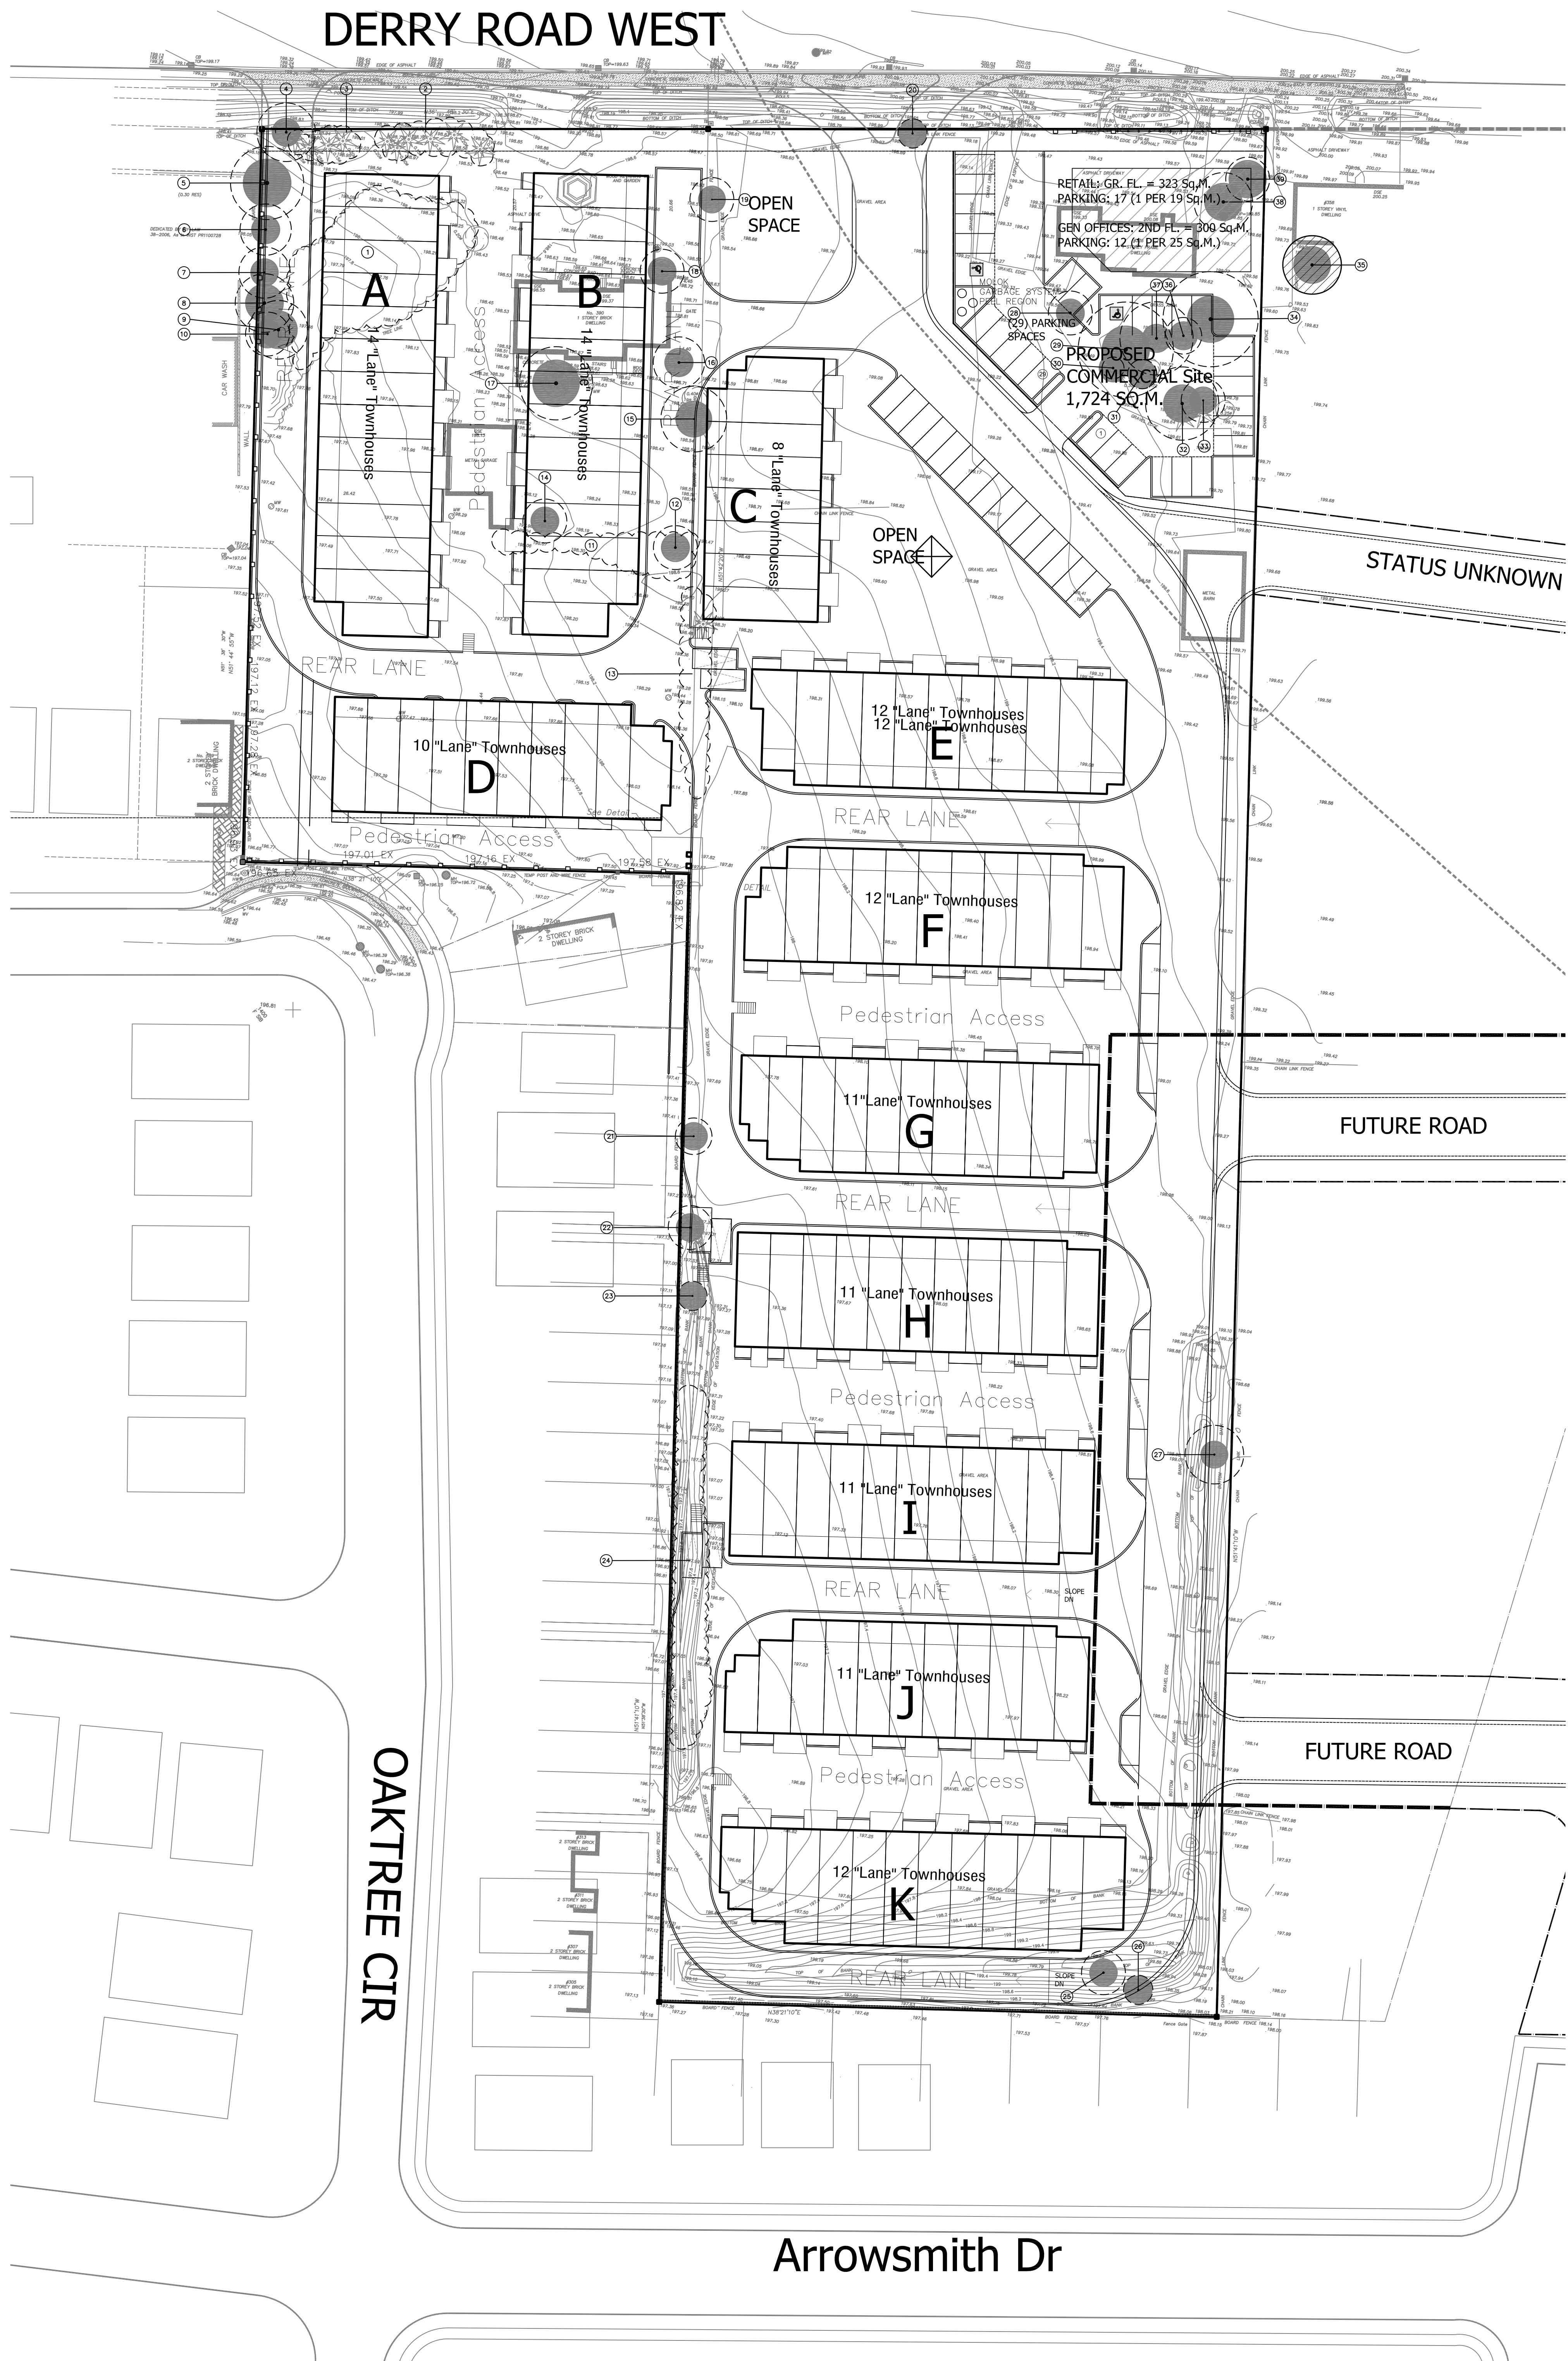

Matthew C. O'Brien
Matthew C. O'Brien
International Society of Arboriculture
Certified Arborist #0N-1144
Date FEB 01, 2018

2	FEB 01, 2018	ISSUED FOR SUBMISSION	MG
1	TBD	ZBA & GPA	GT
No.	DATE	REVISION	BY

It is the responsibility of the Contractor and/or Owner to ensure that the drawings with the latest revisions are used for construction.

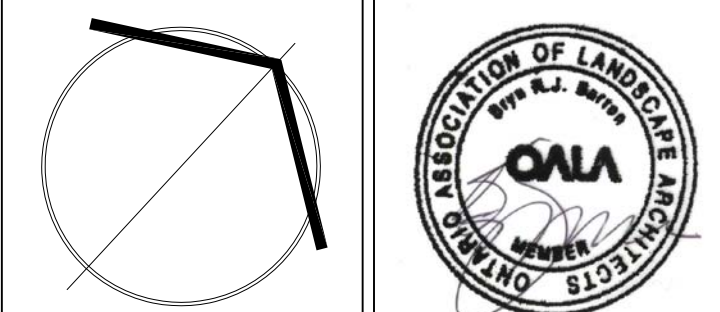

SBK
STRYBOS BARRON KING
LANDSCAPE ARCHITECTURE

3770 HURONTARIO STREET, SUITE 320
MISSISSAUGA, ONTARIO, L4R 3G5
T: 416.695.4949 F: 905.712.3101
WWW.STRYBOS.COM

PROJECT:
376-390 DERRY ROAD WEST
MISSISSAUGA, ONTARIO

376 DERRY DEVELOPMENT INC.
390 DERRY DEVELOPMENT INC.

DRAWING TITLE:
TREE INVENTORY AND
PRESERVATION PLAN

SCALE: 1 : 400	PROJECT No. 17-4968
DATE: JUNE 9, 2017	DRAWING No. V100
DRAWN BY: MK	
CHECKED BY: GT	